

NISSAN DIESEL AMERICA, INC.

TECHNICAL BULLETIN GE-36

DATE: January 2, 2007
 MODEL YEAR: 2005 - 2007
 ENGINE MODEL: J08
 CHASSIS MODEL: UD1800HD ~ UD3300
 BULLETIN NUMBER: GE-36
 FILE IN THE GENERAL SECTION OF THE TECHNICAL BULLETIN BINDER

2005 - 2007 J08 FLYWHEEL RESURFACING SPECIFICATIONS & DETAILS FOR MANUAL TRANSMISSIONS


PURPOSE

The Flywheel thickness specifications and resurfacing details shown on pages EN02-30, CL1-1-2 & CL1-3-9 in the 2005 & 2007 Service Manual CD are incorrect.

ADVISORY

- 1) The correct flywheel thickness specifications are shown below.
- 2) The flywheel is serviceable until thickness (A) reaches the service limit. When grinding, also grind the flange so that the height (H) is within the maintenance standard. If flywheel has to be ground more than 1.0 mm (0.039 in), replace the flywheel.

Unit: MM (in)		
Inspection item	Standard	Limit
Flywheel		
(A) Thickness	(A): 21.0 (0.827)	20.0 (0.787)
(H) Height	(H): 43.0 (1.693)	44.0 (1.732)

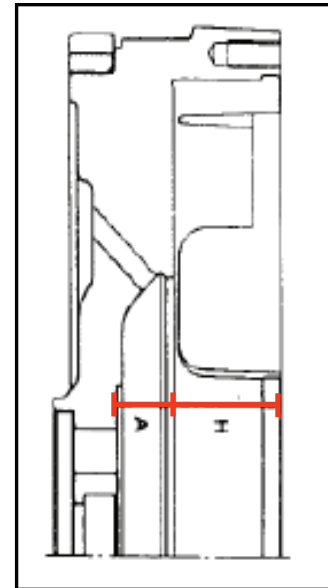

- 3) The NDA online service manual pages have been changed to reflect these correct specifications.

THE INFORMATION CONTAINED IN THIS BULLETIN SHOULD NOT BE INTERPRETED AS THE BASIS FOR WARRANTY CLAIMS							
FOR THE INDICATED PERSONNEL BELOW, PLEASE READ, INITIAL, AND ROUTE TO THE FOLLOWING:							
X	SERVICE MANAGER	X	WARRANTY MANAGER	X SERVICE TECHNICIANS INITIAL BELOW:			
X	PARTS MANAGER	X	SHOP FOREMAN				